

HARDOX[®]
WEAR PLATE

WELDING OF HARDOX[®]



SSAB

CONTENTS

Welding of Hardox® wear plate	3
Methods for joint preparation	4
Heat input	5
Avoiding hydrogen cracking	6
Minimum preheating and interpass temperatures	8
Recommended preheating temperatures	10
Attaining and measuring the preheating temperature	12
Hardfacing	13
Recommendations for minimizing distortion	14
Cooling time $t_{8/5}$	16
Welding sequence and root opening size	17
Welding consumables	18
Stainless steel welding consumables	20
Shielding gas	21
Welding on primer	22
Post-weld heat treatment	22
Latest in welding technology	23



SSAB Welding Handbook

If you like to explore the world of welding even deeper, we recommend the SSAB Welding Handbook. This 132 page document provides a wealth of insights and recommendations for technicians, engineers and other professionals. It contains recommendations for achieving the best welding result when welding Hardox® wear plate and Strenx® performance steel. It describes the thermal flow and cycle, how to eliminate the risk of cracks, HAZ improvements, choice of consumables and filler material, and joint geometry characteristics.

You can download a digital version or order a printed version of the SSAB Welding Handbook at ssab.com/support/steel-handbooks

WELDING OF HARDOX® WEAR PLATE

The Hardox® wear plate range, which also includes sheet, round bars, pipes and tubes, combines unique performance with exceptional weldability. Any conventional welding method can be used for welding Hardox® steel to other weldable steel.

This brochure contains useful tips and information for anyone who wants to simplify and boost the efficiency of their welding processes. It offers advice on preheating and interpass temperatures, heat input, welding consumables and more.

With this practical information, every user can gain the full benefit of the unique properties of Hardox® steels. In the brochure references are made to:

- ▶ TechSupport documents give further information and address topics such as measures to avoid discontinuities. They also give examples of suitable consumables suppliers. TechSupport documents can be found in the Download Center at ssab.com/download-center.
- ▶ WeldCalc™ as a desktop or app version allows users to optimize their welding performance based on the specific conditions and requirements of their welded structure. WeldCalc™ can be downloaded at ssab.com/support/calculators-and-tools.

The information contained in this brochure is provided only as general information. SSAB AB accepts no responsibility for the suitability or appropriateness of any application. It is the user's responsibility to independently determine suitability of all products, and or applications, and to test and verify the same. The information provided by SSAB AB hereunder is provided "as is, where is" and with all faults, and the entire risk associated with such information is with the user.



IMPORTANT PARAMETERS FOR WELDING

To ensure a high-quality weld, clean the weld area to remove moisture, oil, corrosion or any impurities prior to welding. In addition to good welding hygiene, make especially sure you consider the following aspects:

- ▶ Choice of welding consumables
- ▶ Preheating and interpass temperatures
- ▶ Heat input
- ▶ Weld sequence and size of root gap in the joint

METHODS FOR JOINT PREPARATION

Joints can be prepared by conventional methods such as thermal cutting and machining. If thermal cutting is used, a thin oxide or nitride layer will be present that is approximately up to 0.2 mm (0.0079") thick. These layers are removed before welding, usually by grinding.

HEAT INPUT

Most welding procedures are carried out with DC or AC welding. For DC and AC welding, the heat input is calculated according to the following formula.

$$Q = \frac{k \cdot U \cdot I \cdot 60}{v \cdot 1000} \quad \begin{matrix} \text{kJ/mm} \\ \text{(kJ/inch)} \end{matrix}$$

The heat input for pulsed arc welding can be determined by either of the two following formulas:

$$Q = \frac{k \cdot IE}{L \cdot 1000} \quad \begin{matrix} \text{kJ/mm} \\ \text{(kJ/inch)} \end{matrix}$$

or

$$Q = \frac{k \cdot IP \cdot 60}{v \cdot 1000} \quad \begin{matrix} \text{kJ/mm} \\ \text{(kJ/inch)} \end{matrix}$$

Q = Heat input kJ/mm (kJ/inch)
 k = Arc efficiency (dimensionless)
 U = Voltage [V]
 I = Current [A]
 v = Travel speed mm/min (inch/min)
 L = Length of a weld run [mm or inch]
 IE = Instantaneous energy [J]
 IP = Instantaneous power [W]

Various welding processes have different thermal efficiency. Table 1 describes approximate values for different welding methods.

Thermal efficiency factors of different welding methods

WELD METHOD	THERMAL EFFICIENCY (K)
MAG/ GMAW	0.8
MMA/ SMAW	0.8
SAW	1.0
TIG/ GTAW	0.6


Table 1

Excessive heat input increases the width of the heat affected zone (HAZ), which in turn impairs the mechanical properties as well as the wear resistance of the HAZ.

Welding with low heat input provides benefits such as:

- ▶ Increased wear resistance of the HAZ
- ▶ Decreased distortion (single-pass welded joints)
- ▶ Increased toughness of the joint
- ▶ Increased strength of the joint

A very low heat input might, however, negatively affect the impact toughness ($t_{8/5}$ * values below 3 seconds). Table 2 indicates the recommended maximum heat input (Q) for Hardox®.

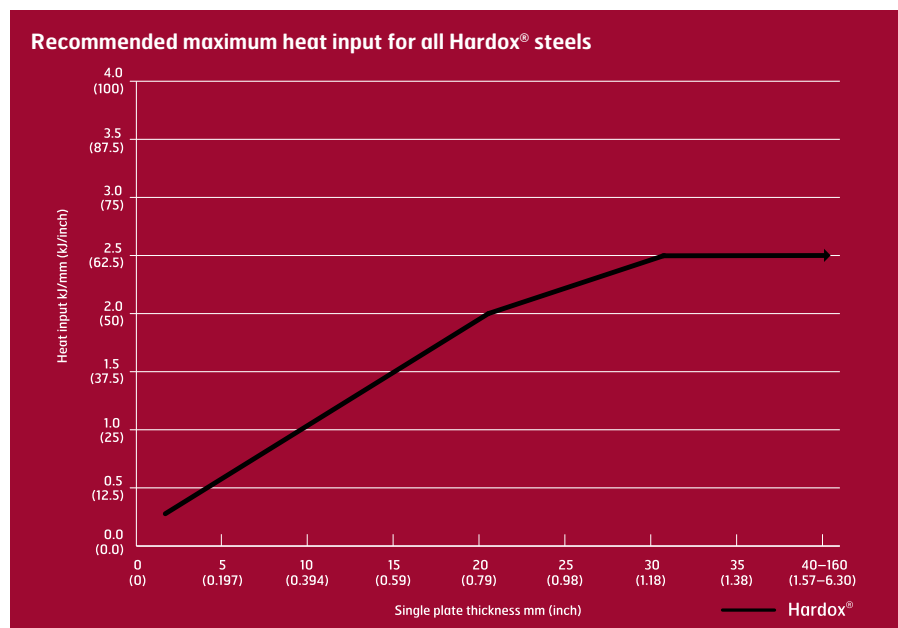

* see definition on page 16

AVOIDING HYDROGEN CRACKING

Due to a relatively low carbon equivalent, all Hardox® grades resist hydrogen cracking better than other wear-resistant steels.


Minimize the risk of hydrogen cracking by following these recommendations:

- ▶ Preheat the weld area to the recommended minimum temperature.
- ▶ Measure the preheat temperature according to preheating recommendations on page 10.
- ▶ Use processes and consumables that provide a maximum hydrogen content of 5 ml/100 g weld metal.
- ▶ Keep the joint clear from impurities like rust, grease, oil or frost.
- ▶ Use only classifications for welding consumables recommended by SSAB. (More on welding consumables on page 18.)
- ▶ Apply a proper welding sequence in order to minimize residual stresses.
- ▶ Place weld starts and stops preferably at least 50-100 mm (2"-4") from a corner in order to avoid excessive stresses in these regions, see Figure 1.
- ▶ Avoid a root opening size exceeding 3 mm (1/8"); see Figure 2.
- ▶ Gap size should not exceed 3 mm (1/8"); see Figure 2.

Figure 1



Figure 2

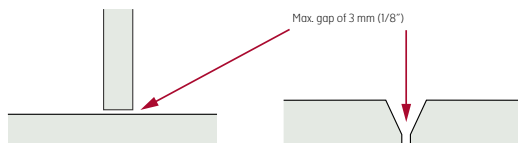



MINIMUM PREHEATING AND INTERPASS TEMPERATURES

It is essential to follow the recommended minimum preheating temperature as well as the procedure for obtaining and measuring the temperature in and around the joint in order to avoid hydrogen cracking.

Influence of alloying elements on the selection of preheating and interpass temperatures

A unique combination of alloying elements optimizes the mechanical properties of Hardox® wear plate. This combination governs preheating and interpass temperatures of Hardox® steel during welding, and can be used to calculate the carbon equivalent. The carbon equivalent is usually expressed as CEV or CET according to the formulas shown to the right.

The alloying elements are specified in the mill certificate of Hardox® steel and are stated in weight percentages in the two formulas below. A higher carbon equivalent usually requires a higher preheating and interpass temperature. The typical carbon equivalent for all Hardox® grades is guaranteed in SSAB's product data sheets which can be found at www.hardox.com.

However, if the min. preheat temperatures stated in this brochure are followed, calculation of the carbon equivalent is not needed.

$$CEV = C + \frac{Mn}{6} + \frac{[Mo+Cr+V]}{5} + \frac{[Ni+Cu]}{15} \quad [%]$$

$$CET = C + \frac{[Mn + Mo]}{10} + \frac{[Cr+Cu]}{20} + \frac{Ni}{40} \quad [%]$$



Preheating and interpass temperatures for the entire Hardox® range of abrasion-resistant steel

Minimum recommended preheat and maximum interpass temperatures during welding are shown in Tables 3, 4a and 4b. Unless otherwise stated, these values are applicable for welding with unalloyed and low-alloyed welding consumables.

- ▶ When plates* of different thicknesses but of the same steel grade are welded together, the thicker plate determines the required preheating and interpass temperatures; see Figure 4.
- ▶ When different steel types are welded together, the plate* requiring the highest preheating temperature determines the required preheat and interpass temperatures.
- ▶ Tables 4a and 4b are applicable for heat inputs of 1.7 kJ/mm (43.2 kJ/inch) or higher. If heat inputs of 1.0 – 1.69 kJ/mm (25.4 – 42.9 kJ/inch) are used, we recommend that you increase the temperature by 25°C (77°F) above the recommended preheating temperature.
- ▶ If a lower heat input than 1.0 kJ/mm (25.4 kJ/inch) is applied, we recommend that you use SSAB's WeldCalc app to calculate the recommended minimum preheating temperature.
- ▶ If the ambient humidity is high or the temperature is below 5°C (41°F), the lowest recommended preheating temperatures given in Table 4a and 4b should be increased by 25°C (77°F).
- ▶ For plates thicker than 25 mm (0.984"), and joint geometries, where the root pass is close to the centerline of the plate such as double-V butt welds, we recommend to shift the root pass approximately 5 mm (0.197") away from the centerline of the plate.

* Plate, sheet, round bar and tube.

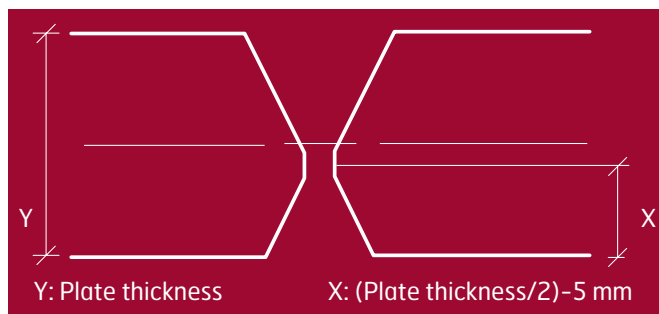


Figure 3

Maximum recommended interpass temperature/preheating temperature

Hardox® HiTemp**	300°C (572°F)
Hardox® HiTuf**	300°C (572°F)
Hardox® HiAce	225°C (437°F)
Hardox® 400/400 Tube and Round bar	225°C (437°F)
Hardox® 450	225°C (437°F)
Hardox® 500/500 Tube	225°C (437°F)
Hardox® 500 Tuf	225°C (437°F)
Hardox® 550	225°C (437°F)
Hardox® 600	225°C (437°F)
Hardox® Extreme	100°C (212°F)

Table 3

** Interpass temperatures of up to approx. 400°C (752°F) can be used in certain cases for Hardox® HiTemp and Hardox® HiTuf. In such cases, use WeldCalc™.

The interpass temperature shown in Table 3 is the maximum recommended temperature in the joint (on top of the weld metal) or immediately adjacent to the joint (start position), just before starting the next weld pass.


The minimum recommended preheating and maximum interpass temperatures shown in Tables 3, 4a and 4b are not affected at heat inputs higher than 1.7 kJ/mm (43.2 kJ/inch). The information is based on the assumption that the welded joint is allowed to air cool to ambient temperature.

Note that these recommendations also apply to tack welds and root runs. In general, each of the tack welds should be at least 50 mm (2") long. For joints with plate thicknesses of up to 8 mm (0.31"), shorter tack lengths may be used. The distance between tack welds can be varied as required.

RECOMMENDED PREHEATING TEMPERATURES


The single plate thickness (diameter) is shown on the x-axis. Minimum recommended preheat and interpass temperatures are given for different single plate thicknesses. Note that every increase in temperature starts at 0.1 mm (0.004") above the indicated thickness in the charts.

Table 4a

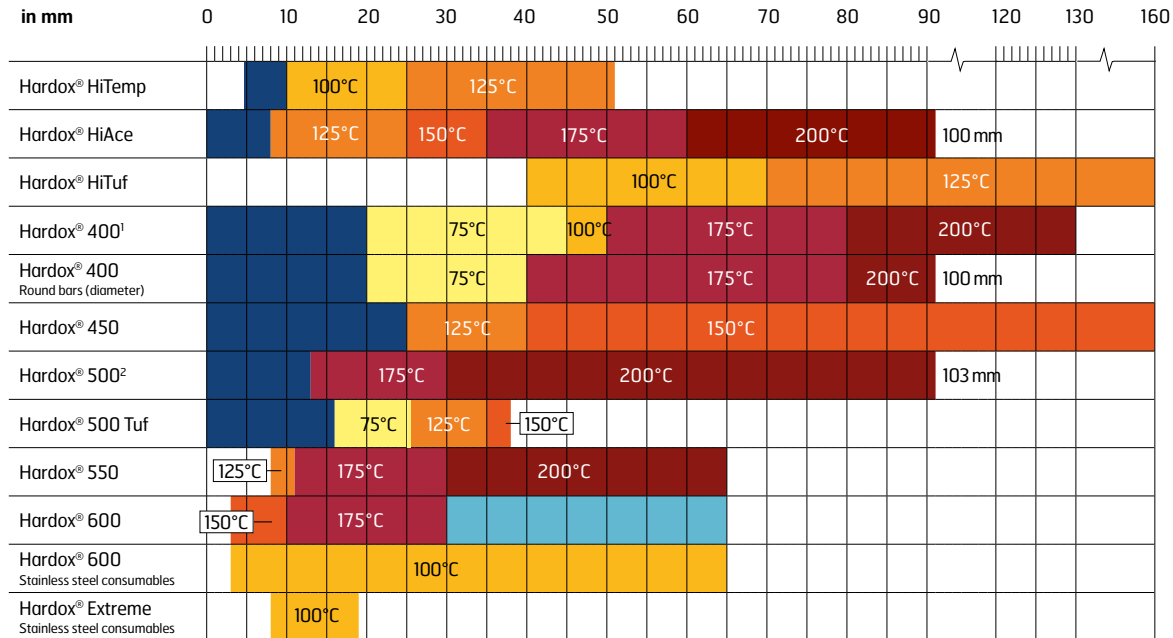

■ Room temperature (approx. 20°C)
 Outside the size range
■ Only stainless steel consumables
 Preheat and interpass temperature at least 100°C

Table 4b

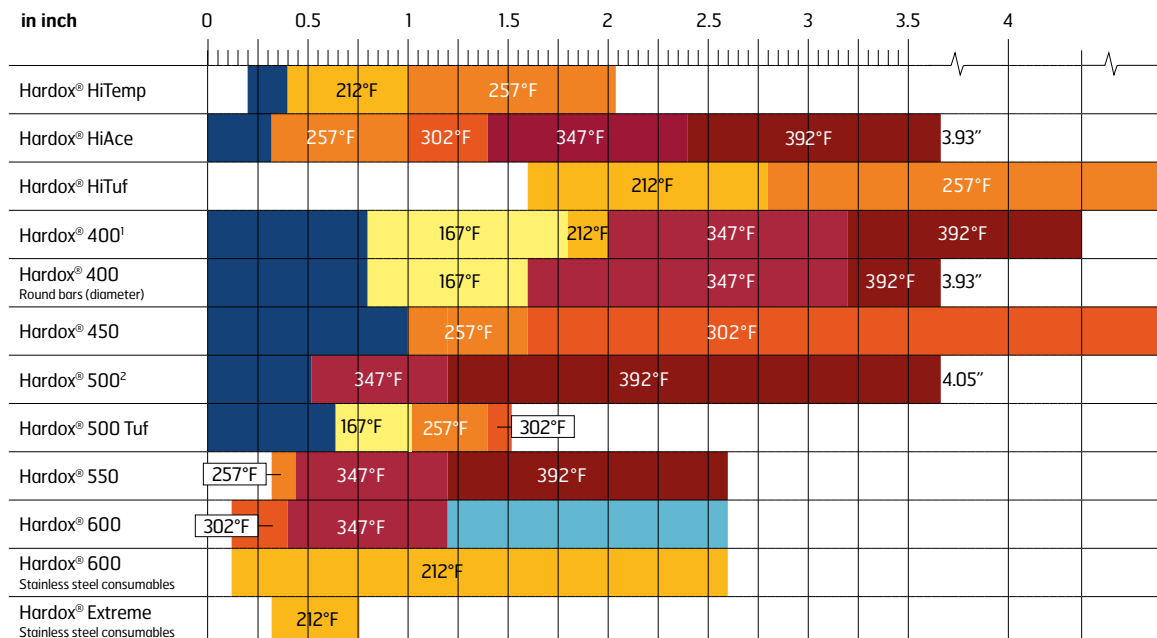


■ Room temperature (approx. 68°F)
 Outside the size range
■ Only stainless steel consumables
 Preheat and interpass temperature at least 212°F

¹ The preheating temperature for Hardox® 400 also applies to Hardox® 400 Tubes, which are available in thickness of 3 - 6 mm (0.118"-0.236").

² The preheating temperature for Hardox® 500 also applies to Hardox® 500 Tubes, which are available in thickness of 3 - 6 mm (0.118"-0.236").

Schematic drawing showing “single plate thickness (diameter)”

Figure 4

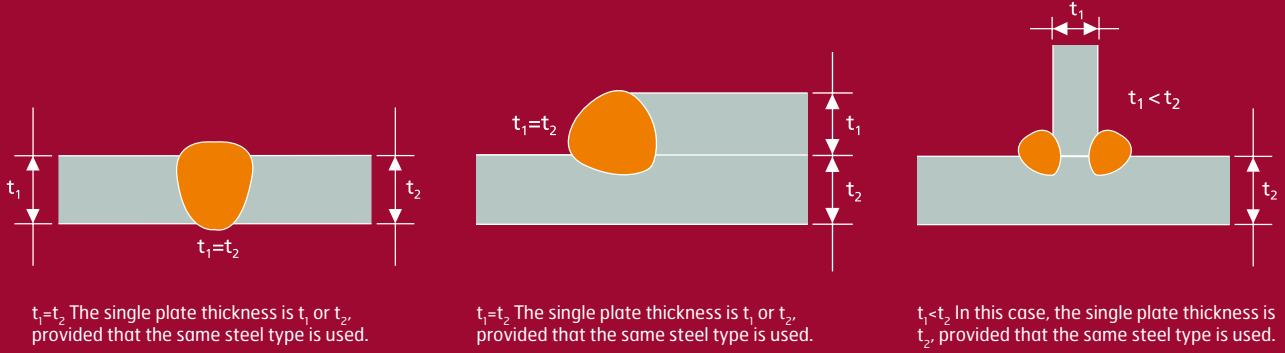

ATTAINING AND MEASURING THE PREHEATING TEMPERATURE

The required preheating temperature can be achieved in several ways. Electric preheater elements (Figure 5) around the prepared joint are often best, since uniform heating of the area can be obtained. The temperature should be monitored by using, for example, a contact thermometer.

Figure 5: Example of electrical heating mats

Recommended preheating operation


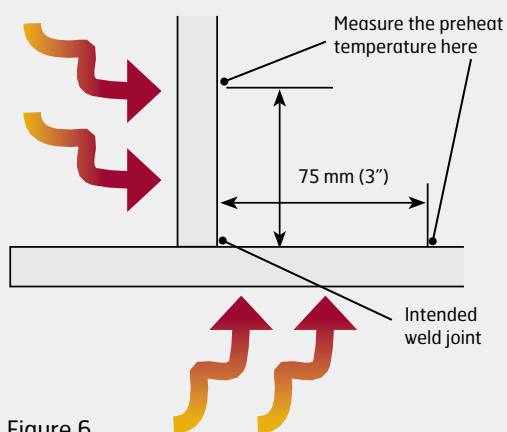


Figure 6

A minimum waiting time of 2 min/25 mm (2 min/1 inch) thickness should be observed before measuring the preheating temperature. The minimum preheating temperature should be obtained in an area of 75 + 75 mm (3" + 3") around the intended weld joint; see above.

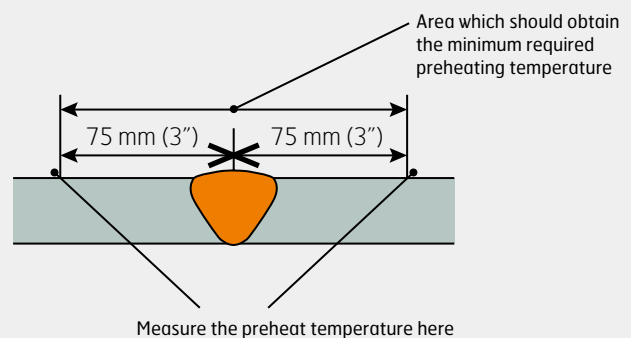

The interpass temperature can also be measured in the weld metal or in the immediately adjacent parent metal.

HARDFACING

If the weld joint is located in an area where high wear is expected, you can employ hardfacing with special consumables to increase the wear resistance of the weld metal. The instructions for both joining and hardfacing Hardox® steel should be followed.

Some consumables for hardfacing require a very high preheat temperature that may exceed the maximum recommended interpass temperature for Hardox® steel.

It is worth noting that using a preheat temperature above the maximum recommended interpass temperature for Hardox® steel may reduce the hardness of the base plate and result in deterioration of wear resistance of the preheated area.

Minimum and maximum preheat temperatures are the same as for conventional types of welding; see Tables 4a and 4b. See Figure 7 for the definition of single plate thickness for hardfacing situations.

It is beneficial to weld a buffer layer with extra-high toughness between the ordinary welded joint or plate and the hardfacing. The choice of consumables for the buffer layer should follow the welding recommendations for Hardox® wear plate. Stainless steel consumables in accordance with AWS 307 and AWS 309 should preferably be used for the buffer layer; see Figure 8.

Figure 7: Definition of single plate thickness


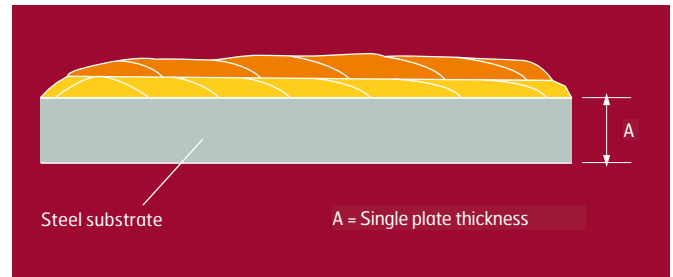


Figure 8: Example of welding sequence using consumables for buffer layer and hardfacing

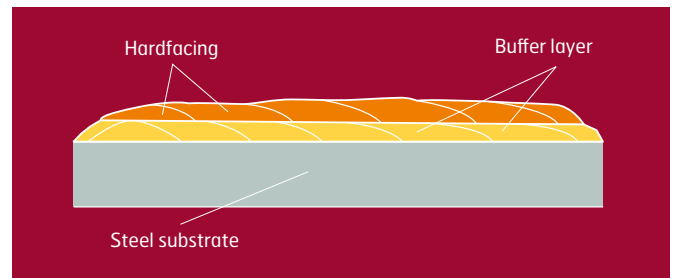

RECOMMENDATIONS FOR MINIMIZING DISTORTION

The amount of distortion during and after welding is related to the base plate thickness and welding procedure. Minimize distortion, particularly when welding thinner gauges, by following these recommendations:

- ▶ Weld with a heat input as low as possible (single pass welded joints).
- ▶ Minimize the cross sectional area; see Figure 9.
- ▶ Use symmetrical welds; see Figure 10.
- ▶ Preset, clamp or angle the parts before welding in order to compensate for the deformation; see example in Figure 11.
- ▶ Avoid an irregular root opening.
- ▶ Minimize reinforcements and optimize the throat thickness of the fillet welds.
- ▶ Decrease spacing between the tack welds.
- ▶ Use a back-step welding technique or a step welding technique. In back-step welding, all weld passes are welded in the opposite direction to the general progression. In skip welding, all weld sequences do not need to be directed opposite to the general progression; see Figure 12.
- ▶ Weld from rigid areas to loose ends, see Figure 13.

Figure 9: Cross section of the weld and how it influences the angle deviation.

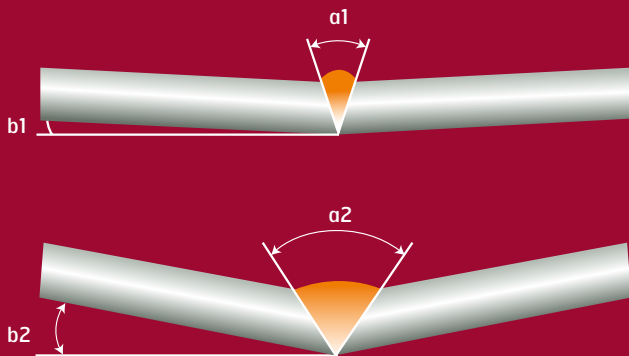


Figure 10



Figure 11: Presetting of a fillet joint and a single-V butt joint.



Figure 12: Use a symmetrical weld sequence.



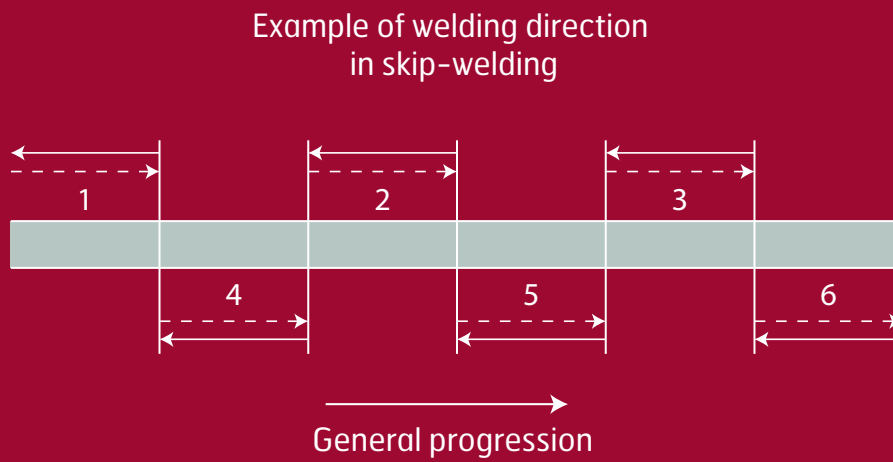


Figure 13

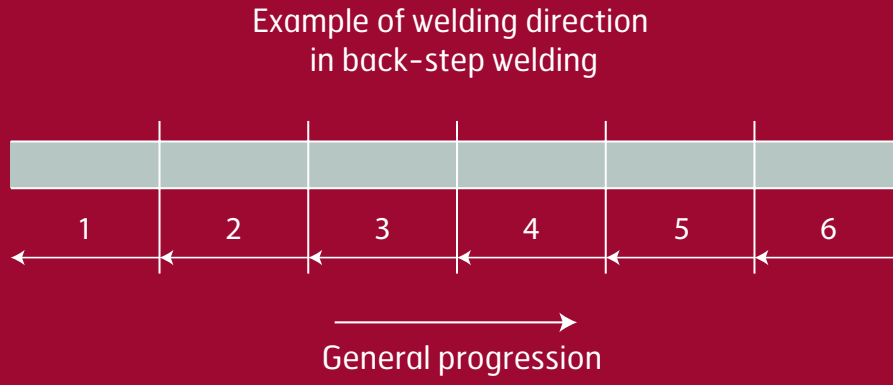

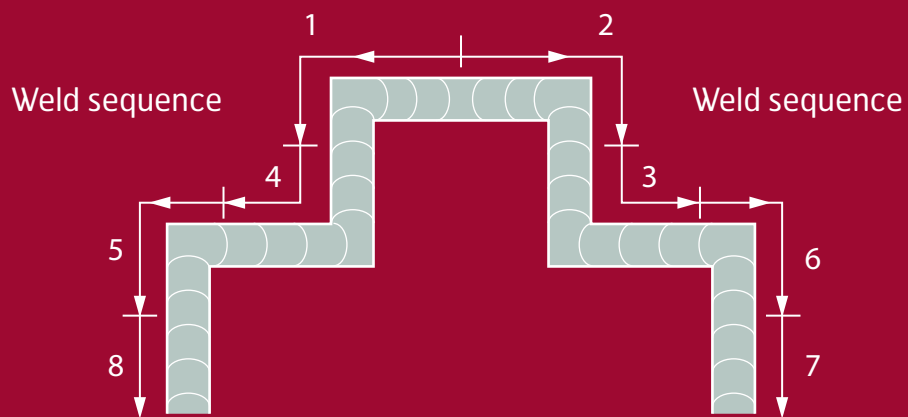

COOLING TIME $t_{8/5}$

The cooling time ($t_{8/5}$) is the time that it takes for the weld to cool from 800° to 500°C (1472° to 932°F), and it gives a good description of the thermal effect from welding.

Recommended cooling times are often provided for structural steels in order to optimize the weld process for a certain requirement, such as meeting the minimum impact toughness.

Recommended maximum cooling times for different Hardox® grades are available in SSAB's WeldCalc app.



WeldCalc™ gives you optimized welding recommendations at your fingertips

The SSAB WeldCalc app provides you with the right welding machine settings, including recommended heat input, preheating temperatures, amps, volts and travel speed. Download the WeldCalc App or the desktop version at ssab.com/support/calculators-and-tools or scan the QR codes below for the iOS and Android apps:



App store





Google play

WELDING SEQUENCE AND ROOT OPENING SIZE

Before tack welding, it is important to maintain a root opening between base plates not exceeding 3 mm (1/8"); see Figure 14. Aim for as uniform a gap size along the joint as possible. Also, avoid weld start and weld stops in highly stressed areas. If possible, the start and stop procedures should be at least 50-100 mm (2"-4") from a corner; see Figure 14. When welding to the edge of plates, a runoff weld tab would be beneficial.

Figure 14: Avoid start and stops in highly stressed areas like corners. Gap size should not exceed 3 mm (1/8").

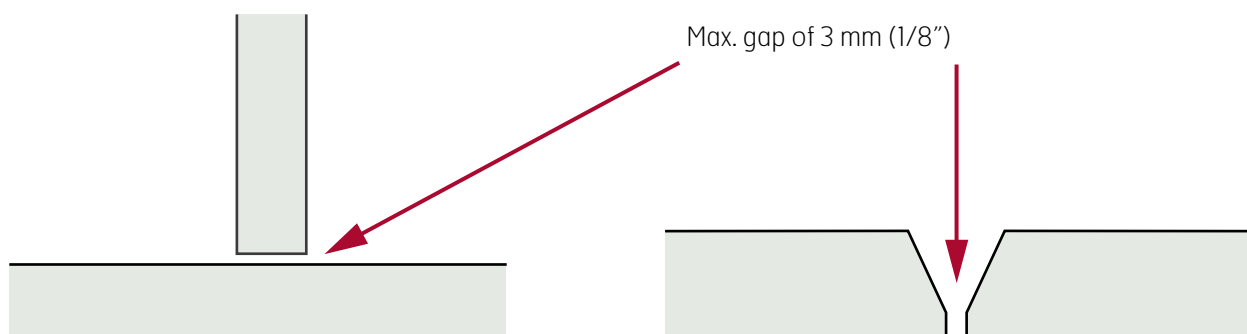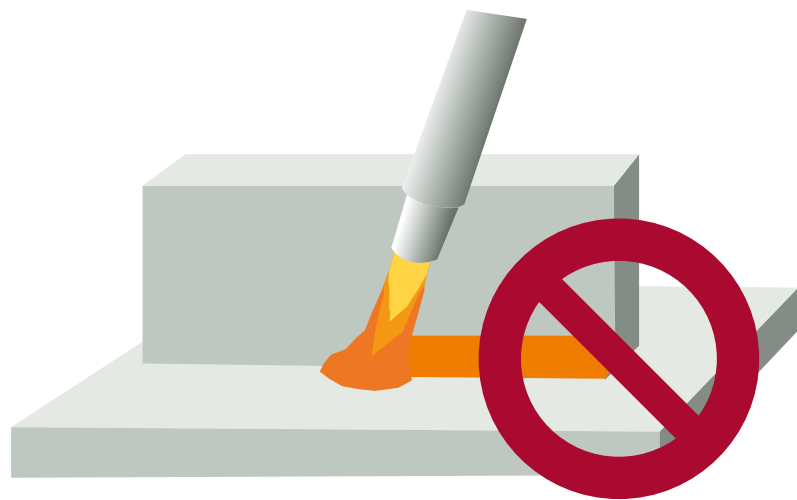

WELDING CONSUMABLES

Strength of unalloyed and low-alloyed welding consumables

Unalloyed and low-alloyed consumables with a maximum yield strength of 500 MPa (72 ksi) are generally recommended for Hardox® steel. Consumables of higher strength (Re max. 900 MPa/130 ksi) may be used for Hardox® 400 and 450 in the thickness range of 0.7-6.0 mm (0.028"-0.236").

Low-alloyed consumables result in higher hardness of the weld metal which can reduce the wear rate of the weld metal. If the wear properties of the weld metal, are essential, the top cap of the joint could be welded with consumables used for hardfacing; see "Hardfacing" on page 13.

In addition, recommended consumables for Hardox® steel and their designations according to AWS and EN classifications can be found in Table 5.

Requirements on hydrogen content of unalloyed and low-alloyed welding consumables

The hydrogen content should be lower than or equal to 5 ml of hydrogen per 100 g of weld metal when welding with unalloyed or low-alloyed welding consumables.

Solid wire used in MAG/ GMA and TIG/ GTA welding can produce these low hydrogen contents in weld metal. Hydrogen content for other types of welding consumables should be obtained from the respective manufacturers. SSAB provides examples of suitable consumables in TechSupport No. 60, available on our homepage: ssab.com.

If consumables are stored in accordance with the manufacturer's recommendations, the hydrogen content will be maintained to meet the requirement stated below. This also applies to all coated consumables and fluxes.

Table 5: Recommended consumables for all steels in the Hardox® wear plate product range

WELDING METHOD	AWS CLASSIFICATION	EN CLASSIFICATION
MAG/ GMAW, solid wire	AWS A5.28 ER70X-X	EN ISO 14341-A- G 42x
	AWS A5.28 ER80X-X	EN ISO 14341-A- G 46x
MAG/ MCAW, metal cored wire	AWS A5.28 E7XC-X	EN ISO 17632-A- T 42xH5
	AWS A5.28 E8XC-X	EN ISO 17632-A- T 46xH5
MAG/ FCAW, flux cored wire	AWS A5.29 E7XT-X	EN ISO 17632 -A- T 42xH5
	AWS A5.29 E8XT-X	EN ISO 17632 -A- T 46xH5
MMA (SMAW, stick)	AWS A5.5 E70X	EN ISO 2560-A- E 42xH5
	AWS A5.5 E80X	EN ISO 2560-A- E 46xH5
SAW	AWS A5.23 F49X	EN ISO 14171-A- S 42x
	AWS A5.23 F55X	EN ISO 14171-A- S 46x
TIG/ GTAW	AWS A5.18 ER70X	EN ISO 636-A- W 42x
	AWS A5.28 ER80X	EN ISO 636-A- W 46x

Note: X stands for one or more characters.



STAINLESS STEEL WELDING CONSUMABLES

Consumables of austenitic stainless steels can be used for welding all Hardox® products, as shown in Table 6. They allow welding at room temperature between 5-20°C (41-68 °F) without preheating, except for Hardox® 600 and Hardox® Extreme.

SSAB recommends giving first preference to consumables in accordance with AWS 307 and second preference to those in accordance with AWS 309. These types of consumables have a yield strength of up to approximately 500 MPa (72 ksi) in all weld metal.

The AWS 307 type can withstand hot cracking better than AWS 309. It should be noted that manufacturers seldom specify the hydrogen content of stainless steel consumables, since hydrogen does not affect the performance as much as it does in unalloyed and low-alloyed consumables. SSAB does not impose any restrictions on the maximum hydrogen content for these types of consumables. Examples of suitable stainless consumables can be found in TechSupport No. 60, available at ssab.com.

Table 6: Recommended stainless steel consumables for the Hardox® wear plate product range

WELDING METHOD	AWS CLASSIFICATION	EN CLASSIFICATION
MAG/ GMAW, solid wire	Recommended: AWS A5.9: ER307 Suitable: AWS A5.9: ER309	Recommended: EN ISO 14343-A: B 18 8 Mn/ EN ISO 14343-B: SS307 Suitable: EN ISO 14343-A: B 23 12 X/ EN ISO 14343-B: SS309X
MAG/ MCAW, metal cored wire	Recommended: AWS A5.9: EC307 Suitable: AWS A5.9: EC309	Recommended: EN ISO 17633-A: T 18 8 Mn/ EN ISO 17633-B: TS307 Suitable: EN ISO 17633-A: T 23 12 X/ EN ISO 17633-B: TS309X
MAG/ FCAW, flux cored wire	Recommended: AWS A5.22: E307T-X Suitable: AWS A5.22: E309T-X	Recommended: EN ISO 17633-A: T 18 8 Mn/ EN ISO 17633-B: TS307 Suitable: EN ISO 17633-A: T 23 12 X/ EN ISO 17633-B: TS309X
MMA/ SMAW, stick	Recommended: AWS A5.4: E307-X Suitable: AWS A5.4: E309-X	Recommended: EN ISO 3581-A: 18 18 Mn/ EN ISO 3581-B: 307 Suitable: EN ISO 3581-A: 22 12 X/ EN ISO 3581-B: 309X
SAW	Recommended: AWS A5.9: ER307 Suitable: AWS A5.9: ER309	Recommended: EN ISO 14343-A: B 18 8 Mn/ EN ISO 14343-B: SS307 Suitable: EN ISO 14343-A: S 23 12 X/ EN ISO 14343-B: SS309X
TIG/ GTAW	Recommended: AWS A5.9: ER307 Suitable: AWS A5.9: ER309	Recommended: EN ISO 14343-A: W 18 8 Mn/ EN ISO 14343-B: SS307 Suitable: EN ISO 14343-A: W 23 12 X/ EN ISO 14343-B: SS309X

Note: X stands for one or more characters.

SHIELDING GAS

Shielding gases for Hardox® wear plate are generally the same as usually selected for unalloyed and low-alloyed steels.

Shielding gases used for MAG/GMA welding of Hardox® steels usually contain a mixture of argon (Ar) and carbon dioxide (CO₂). A small amount of oxygen (O₂) is sometimes used together with Ar and CO₂ in order to stabilize the arc and reduce the amount of spatter.

A shielding gas mixture of about 18–20% CO₂ in argon is recommended for manual welding, which facilitates good

penetration in the material with a reasonable amount of spatter. If automatic or robot welding is used, a shielding gas containing 8–10% CO₂ in argon could be used in order to optimize the weld result with regards to the productivity and spatter level.

Effects of various shielding gas mixtures can be seen in Figure 15. Recommendations for shielding gas in different welding methods can be found in Table 7. Shielding gas mixtures mentioned in Table 7 are general mixtures that can be used for both short-arc and spray-arc welding.

Figure 15: Shielding gas mixtures and their effect on the welding operation

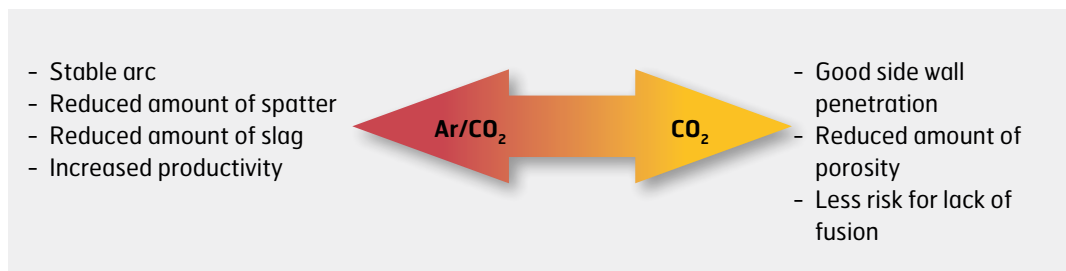


Table 7: Examples of shielding gas mixtures and recommendations

WELDING METHOD	ARC TYPE	POSITION	SHIELDING GAS
MAG/ GMAW, solid wire	Short arc	All positions	18 – 25% CO ₂ in Ar
MAG/ MCAW, metal cored wire	Short arc	All positions	18 – 25% CO ₂ in Ar
MAG/ GMAW, solid wire	Spray arc	Flat position	15 – 20% CO ₂ in Ar
MAG/FCAW, flux cored wire	Spray arc	All positions	15 – 20% CO ₂ in Ar
MAG/MCAW, metal cored wire and FCAW basic flux cored wire	Spray arc	Flat position	15 – 20% CO ₂ in Ar
Robotic and automated MAG/GMAW	Spray arc	Flat position	8 – 18 % CO ₂ in Ar
TIG/ GTAW		All positions	100% Ar

In all welding methods based on shielding gas, the flow of shielding gas depends on the welding situation. As a general guideline, the shielding gas flow in l/min should be set to the same value as the inside diameter of the gas nozzle measured in mm.

WELDING ON PRIMER

You can weld directly on the primer used on Hardox® wear plate thanks to its low zinc content. The primer can be easily brushed or ground away in the area around the joint; see image below.

Removing primer prior to welding can be beneficial, since it can minimize the porosity in the weld and can facilitate out-of-position welding. If primer remains on the weld surface, then the sub-surface and surface porosity of the weld may be slightly higher. FCAW with basic flux offers the lowest porosity.

It is important to maintain good normal ventilated manufacturing premises to avoid the harmful effect the primer could have on the welder and surroundings.



The primer is easy to brush away if necessary

POST-WELD HEAT TREATMENT

Hardox® HiTuf and Hardox® HiTemp can be stress relieved by post-weld heat treatment, although this is rarely necessary. Other Hardox® steels should not use this method for stress relieving, since this may impair the mechanical properties. For more information, consult the Welding Handbook from SSAB. Download your complimentary copy of SSAB's Welding Handbook at ssab.com/support/steel-handbooks.





THE LATEST IN WELDING TECHNOLOGY

At SSAB's own welding stations at our R&D Centers, we continuously test cutting-edge technologies and machines to bring you the best welding recommendations.

With SAW narrow-gap technology using one or two wires, you can weld thicker plate thicknesses of the Hardox® wear plate. You get high-quality results with less welding wire and flux powder while reducing machine runtime, saving energy and lowering production costs. And with SAW ICE (integrated cold electrode), you can use a higher welding speed, a lower heat input and get a higher deposition rate than with conventional methods.

Whichever process is right for you, we'll help make sure you achieve better welded material properties and higher productivity rates.

SSAB is a Nordic and US-based steel company that builds a stronger, lighter and more sustainable world through value added steel products and services. Working with our partners, SSAB has developed SSAB Fossil-free™ steel and plans to reinvent the value chain from the mine to the end customer, largely eliminating carbon dioxide emissions from our own operations. SSAB Zero™, a largely carbon emission-free steel based on recycled steel, further strengthens SSAB's leadership position and our comprehensive, sustainable offering independent of the raw material. SSAB has employees in over 50 countries and production facilities in Sweden, Finland and the US. SSAB is listed on Nasdaq Stockholm and has a secondary listing on Nasdaq Helsinki. Join us on our journey! www.ssab.com, Facebook, Instagram, LinkedIn, X and YouTube.

Explore the world of Hardox® wear plate



SSAB
SE-613 80 Oxelösund
Sweden

T +46 155 25 40 00
F +46 155 25 40 73
contact@ssab.com

hardox.com

Hardox® is a trademark of the SSAB group of companies. All rights reserved. The information contained in this brochure is provided only as general information. SSAB AB accepts no responsibility for the suitability or appropriateness of any application. It is the user's responsibility to independently determine suitability of all products, and or applications, and to test and verify the same. The information provided by SSAB AB hereunder is provided "as is, where is" and with all faults, and the entire risk associated with such information is with the user.